

# Manhole Inspection Summary

Manhole # S19A\_\_023MH

Printed On: 9/30/2009

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **19A** Node: **023** Status: **Found**

Insp Date: **9/21/09 10:29 AM**

Incomplete Comments

Crew: **ADS4**  
Inspector: **ADS4**  
Firm: **ADS**

**Location** Address: **807 LANVALE ST**

Cross Street: **SPEDDEN ST**

**Manhole** Type: **Junction**

Location: **Grass**

Ground Conditions: **Wet**

☐ Prev. Rehab

Weather: **Light Rain**

Subject To Ponding: **None**

Comments **there is a hole between frame and chimney**

**Cover**

Shape: **Circular**

Diameter: **30** (in.) Length: (in.) Dist A/B Grade: **12** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame**

Offset: **8** (in.)

Condition: ☐ Sound

☐ Cracked

☒ **Leaks**

**Chimney / Frame Adjustment**

☐ Exists

Material:

☐ Parged

Height: (in.)

Condition: ☐ Sound

☐ Cracked

☐ Root Intrusion

☐ Loose Brick

☐ Deteriorated

Infiltration: ☐ None

☐ Joint

☐ Cracks

☐ Mortar

☐ Roots

☐ Wall

**Corbel**

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☐ Sound

☐ Cracked

☐ Root Intrusion

☐ Loose Brick

☒ **Deteriorated**

Infiltration: ☐ None

☒ **Joint**

☐ Cracks

☐ Mortar

☐ Roots

☒ **Wall**

**Barrel**

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **52** (in.) Length: (in.)

Condition: ☒ Sound

☐ Cracked

☐ Root Intrusion

☐ Loose Brick

☐ Deteriorated

Infiltration: ☒ None

☐ Joint

☐ Cracks

☐ Mortar

☐ Roots

☐ Wall

**Bench**

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound

☐ Cracked

☐ Root Intrusion

☐ Deteriorated

☐ Leaks

☐ Debris

**Channel**

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open**

Junc Dist: **0**

nearest .5 ft. Azimuth:

Condition: ☐ Sound

☐ Cracked

☐ Root Intrusion

☐ Deteriorated

☐ Leaks

☒ **Debris**

**Steps**

Count: **9**

Missing: **0**

☐ Corroded

**Surcharge**

☐ Evidence Of Surcharge

Depth:

(ft.)

☐ Active Surcharge Present

# Manhole Inspection Summary

Manhole # S19A\_\_023MH

Printed On: 9/30/2009

Page 2 of 4

Location View



GRADE ADJUSTMENT

Top View



ABANDONED PIPE AT I9

Defect 1



FRAME OFFSET

Defect 4



INFILTRATION OF CORBEL JOINT

Defect 3



INFILTRATION OF DETERIORATED CORBEL WALL

Defect 2



HOLE BETWEEN FRAME AND CHIMNEY

## Manhole Inspection Summary


Manhole # S19A\_\_023MH

Printed On: 9/30/2009

Page 3 of 4

8 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow

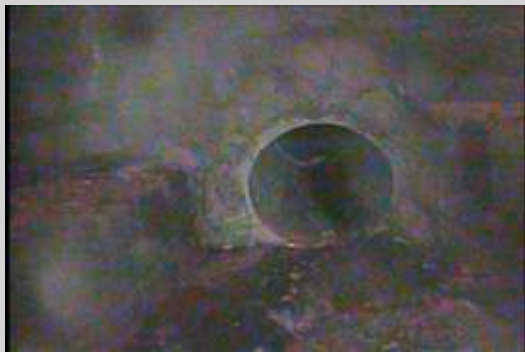

Pipe Height: **8.4** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **15.43** (ft.) Flow Characteristics: **Slow**  
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ **Debris** ☐ Grease  
Silt Depth: (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 3 O'Clock

3 O'Clock Inflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **11.87** (ft.) Flow Characteristics: **Slow**  
Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease  
Silt Depth: **1** (in.) Deposits Extent: **Light**  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop In @ 3 O'Clock



Drop: **Outside** Rod and Bar  
Angled: **Yes** Reading: **14.39** (ft.)  
Inv Depth: **15.39** (ft.)  
Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection

# Manhole Inspection Summary

Manhole # S19A\_\_023MH

Printed On: 9/30/2009

Page 4 of 4

8 in. Circular Gravity Sewer

6 O'Clock Inflow

Pipe In @ 6 O'Clock

Drop In @ 6 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.70** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **2** (in.) Deposits Extent: **Medium**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **Outside** **Rod and Bar**  
Angled: **Yes** Reading: **14.31** (ft.)  
Inv Depth: **15.31** (ft.)

Drop Condition: **Open**

Connects To: **Out of Sewer Shed (No Info)**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

9 O'Clock Inflow

Pipe In @ 9 O'Clock

Drop In @ 9 O'Clock



Pipe Height: (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **11.98** (ft.) Flow Characteristics: **None**

Deposits: ☒ **None** ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **Inside** **Direct**  
Angled: Reading: (ft.)  
Inv Depth: **15.42** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection